Dear Sir, Madam

As part of its policy of continuous improvement, Hill-Rom has developed a partnership with Docapost (La Poste Group in France) for the distribution of the safety instructions or information related to the Hill-Rom medical devices.

You will find enclosed the regulatory document and the response form which must be returned to attest to the confirmation of receipt.

Once completed, your response form must be returned to our partner Docapost via mail, email or fax, who will process the document management responses.

Thank you to fill in the form clearly and legibly and check the proposed options. This will allow our local coordinator to manage the necessary elements and to follow up in a timely manner.

Response form to be returned to:

DOCAPOST BPO IS
HILL ROM MODS
Energy Park
150 Boulevard de Verdun
92400 Courbevoie – France

Or, Fax: +33(0)1 46 35 97 98

Or, Email: hill-rom.mods@docapost-bpo.com

Best Regards

Regulatory Affairs Department Hill-Rom.



Urgent Field Safety Notice

Subject: Liko® Viking® L, Viking® M, Viking® XL, and Viking® 300 Mobile Lifts -

Potential Actuator Damage

FSCA-identifier: Mod 1228

Type of action: Corrective Action Notification

Date:

To: Chief Executive

Facility Risk Manager
Facility Administrator
Facility Engineer
Vigilance Manager
Biomedical Engineering
Medical Device Liaison Officer

Affected Models and Serial numbers:

Viking® M Lift

- Model 2040035 (S/N 9 200 000 9 203 000)
- Model 2040015 (S/N 7 500 401 7 570 000)
- Model 2040005 (S/N 7 100 101 7 200 200)
- Viking® L Lift
 - Model 2040004 (S/N 7 200 201 7 300 300)
- Viking® XL or Viking® 300 Lift
 - Model 2040003 (S/N 800 001 804 999)

Background:

Hill-Rom has received 9 complaints where it is alleged that the lift arm drifted down suddenly on certain Viking® Mobile Lifts.


This issue is preceded by users who lift the lift arm assembly manually, as shown in the illustration to the right.

The lift arm assembly is intended to only be lifted by the actuator (lift motor). If the lift arm assembly is manually lifted, the actuator can become damaged and get stuck in the highest position. When the actuator is stuck, the lift cannot be raised/lowered by the lift motor. If a patient is lifted into the sling while the actuator is stuck, there is a potential risk of a free fall of the patient. This hazard could cause minor or potentially catastrophic injuries to a patient if the free fall encompasses the entire stroke of the actuator.

Hill-Rom requests customers not to raise the lift arm manually since

the lifting actuator can become stuck and/or become damaged. Always use the hand controls or the control box to operate the lift. There are no hazards when using the device as intended. Hill-Rom is updating the product labelling to address this hazard.

Hill-Rom is concerned that the actuator may have become damaged from manually lifting, therefore, is more susceptible to becoming stuck in the highest position if manually lifted again. To reduce the risk of this occurring, Hill-Rom is announcing a correction that will include an inspection of all potentially affected Viking® lifts. If there is damage to the actuator, it will be replaced.

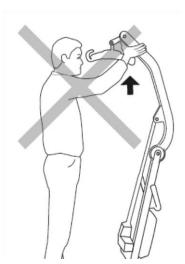



Action to be taken:

Hill-Rom is conducting a correction in two phases.

Phase 1 will be this letter and information to enable you to update the Instruction Guides. Phase 2 will include the physical inspection of potentially affected devices. A part of the inspection is to apply an informative sticker to the lift.

If your lift is already equipped with the sticker (see example to the right), it is already inspected and no further action is required.

Phase 1: Labelling update

This letter shall serve as the labelling update to warn against manually lifting the lift arm assembly. Please use the insert attached to this letter to update the following Viking® Mobile Lift instruction guides. Complete instruction guides with the updated labelling incorporated in the document are available from Hill-Rom.

7EN137105

7EN137106

7EN137102

7EN136102

7EN135104

7EN135102

Please fill in the attached response form and return to Hill-Rom. This will provide us with the necessary information to plan the inspection in Phase 2.

Phase 2: Inspection

If you have affected units and you have returned the response form, you will be contacted by Hill-Rom or one of Hill-Rom's distributors, to schedule an inspection of your potentially affected devices. If there is damage to the actuator consistent with manually lifting, the actuator will be replaced by Hill-Rom.

Transmission of this Field Safety Notice:

Please pass this notice on to all those who need to be aware within your organization and/or to any organization where the affected devices have been transferred.

Please maintain awareness of this notice and resulting action for an appropriate period to ensure effectiveness of the corrective action.

Hill-Rom confirms that the relevant Competent Authorities have been informed of this Field Safety Notice.

Contact reference person:

If you have any questions concerning this Field Safety Notice, please contact Hill-Rom Technical Support, your distributor, or your Hill-Rom representative.

Regards,

Hill-Rom Technical Support

Attachment: Response Form/Receipt, Viking® Mobile Lift Instruction Guide Insert





Response Form / Receipt

Subject: Potential Actuator Damage on Viking® M, L, XL, or Viking® 300 Mobile Lifts (ref: MOD1228)

It is important that you return this form/receipt as acknowledgement of your receipt and provide us with the necessary information to correct your equipment.

Please complete the following with the correct information, and **return this Response Form** without delay. See specific instructions at bottom of page. Thank you!

Hill-Rom account number:		
Name of the facility:		
Address of the facility:		
City:	Zip:	_ Country:
Facility Authorized Name: (print)_		
Signature:		Date:/
Title:	Phone:	
Email:	Fax	c:
☐ The delivery address indicated correspondence Check action taken:	l in the cover page is not my current address. Use	e above details for future
☐ We do not have any potentiall	ly affected products.	
☐ We want to be contacted by Hi	ill-Rom for further information.	
☐ We have potentially affected Mobile Lift Instruction Guide.	products and have inserted the new instruction.	into the Viking® M, L, XL, or 300
Note the potentially affected produ header: Unit/units of Viking	ucts, only include the serial number ranges of the g^{\otimes} M Mobile Lifts	e devices in the customer notification
Unit/units of Viking	g® L and Viking® XL/300 Mobile Lifts	
☐ We have forwarded the letter (make copies as needed)	r to the following consignees that we have distrib	outed the potentially affected lift to:
Name / Contact:		
Address:		
City / State:		
Phone:		
QS10051 REV 7	190813 REV 1	GD: QS0638



Response form to be returned to:

DOCAPOST BPO IS
HILL ROM MODS
Energy Park
150 Boulevard de Verdun
92400 Courbevoie— France


or Fax:+33(0)1 46 35 97 98

or Email: hill-rom.mods@docapostbpo.com





Insert for your Viking® Lift Instruction Guide

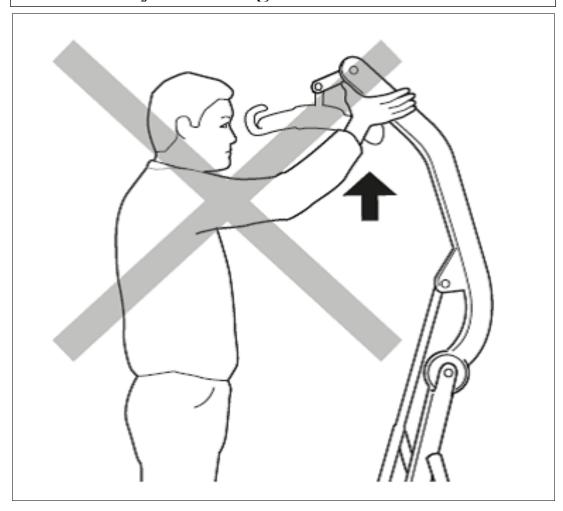

△ Do not raise the lift arm manually!